



wire to steel plate or pipe connections



SHTA

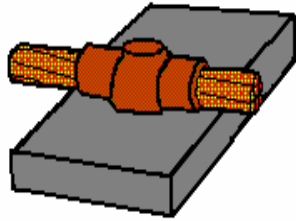

SHEB

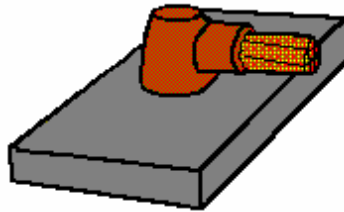


SHEA

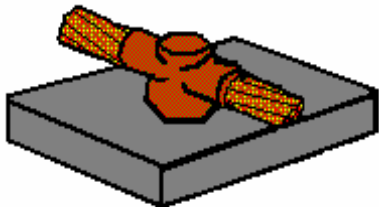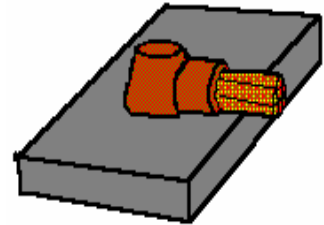


SHTB


SVES

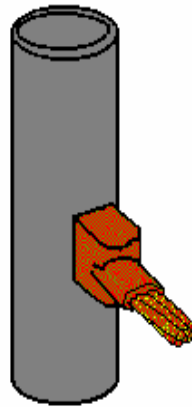



SVES

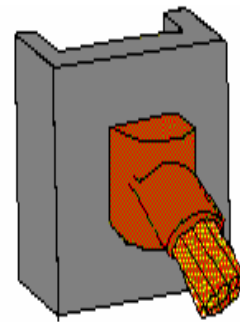


SVEU

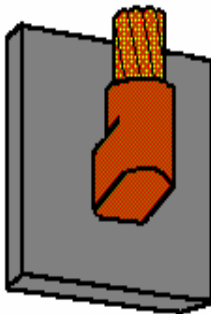


SVEH

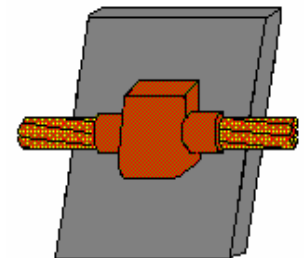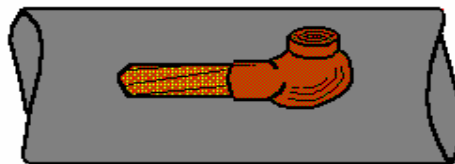



SVTHA

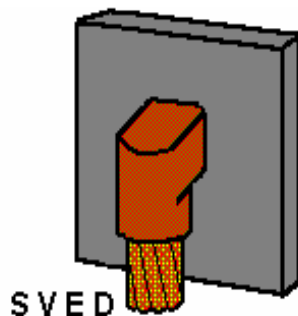

SVED


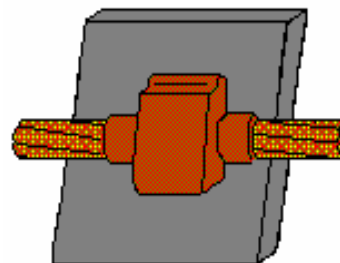


SVTHB

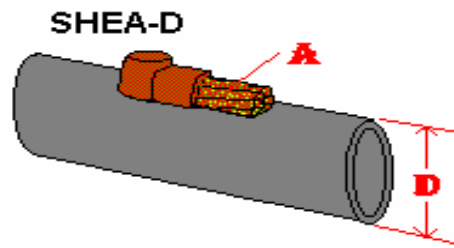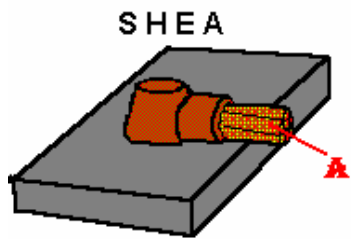



A	MOLD	P	W/M
16 mm ²	SHEA-16	1	45
25	SHEA-25	1	45
30	SHEA-30	1	45
35	SHEA-35	1	65
50	SHEA-50	1	90
70	SHEA-70	3	115
95	SHEA-95	3	115
120	SHEA-120	3	115
150	SHEA-150	3	150
185	SHEA-185	3	200
240	SHEA-240	3	200
300	SHEA-300	3	250

A	MOLD	P	W/M
16 mm ²	SHEA-16-D	1	45
25	SHEA-25-D	1	45
30	SHEA-30-D	1	45
35	SHEA-35-D	1	65
50	SHEA-50-D	1	90
70	SHEA-70-D	3	115
95	SHEA-95-D	3	115
120	SHEA-120-D	3	115
150	SHEA-150-D	3	150
185	SHEA-185-D	3	200
240	SHEA-240-D	3	200
300	SHEA-300-D	3	250

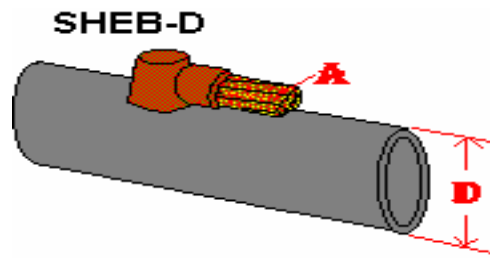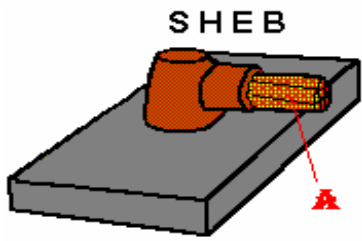



A	MOLD	P	W/M
16 mm ²	SHEB-16	1	45
25	SHEB-25	1	45
30	SHEB-30	1	45
35	SHEB-35	1	65
50	SHEB-50	3	90
70	SHEB-70	3	115
95	SHEB-95	3	115
120	SHEB-120	3	115
150	SHEB-150	3	150
185	SHEB-185	3	200
240	SHEB-240	3	200
300	SHEB-300	3	250

A	MOLD	P	W/M
16 mm ²	SHEB-16-D	1	45
25	SHEB-25-D	1	45
30	SHEB-30-D	1	45
35	SHEB-35-D	1	65
50	SHEB-50-D	3	90
70	SHEB-70-D	3	115
95	SHEB-95-D	3	115
120	SHEB-120-D	3	115
150	SHEB-150-D	3	150
185	SHEB-185-D	3	200
240	SHEB-240-D	3	200
300	SHEB-300-D	3	250

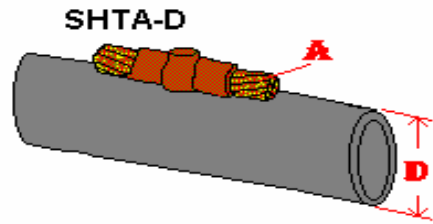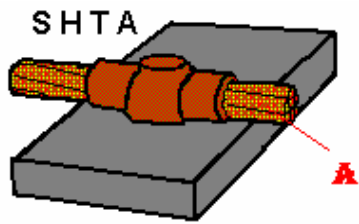



A	MOLD	P	W/M
16 mm ²	SHTA-16	1	45
25	SHTA-25	1	45
30	SHTA-30	1	45
35	SHTA-35	1	65
50	SHTA-50	3	90
70	SHTA-70	3	115
95	SHTA-95	3	150
120	SHTA-120	3	150
150	SHTA-150	3	200
185	SHTA-185	3	250
240	SHTA-240	4	2x150
300	SHTA-300	4	2x200

A	MOLD	P	W/M
16 mm ²	SHTA-16-D	1	45
25	SHTA-25-D	1	45
30	SHTA-30-D	1	45
35	SHTA-35-D	1	65
50	SHTA-50-D	3	90
70	SHTA-70-D	3	115
95	SHTA-95-D	3	150
120	SHTA-120-D	3	150
150	SHTA-150-D	3	200
185	SHTA-185-D	3	250
240	SHTA-240-D	4	2x150
300	SHTA-300-D	4	2x200

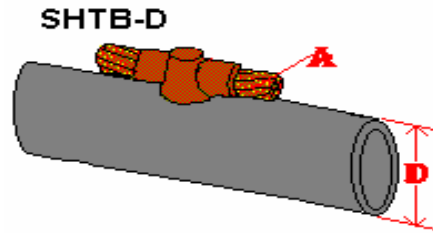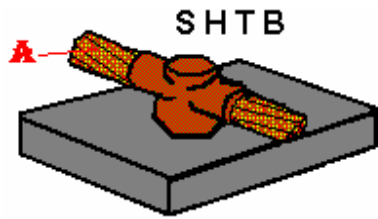



A	MOLD	P	W/M
16 mm ²	SHTB-16	1	45
25	SHTB-25	1	45
30	SHTB-30	1	45
35	SHTB-35	1	65
50	SHTB-50	3	90
70	SHTB-70	3	115
95	SHTB-95	3	150
120	SHTB-120	3	150
150	SHTB-150	3	200
185	SHTB-185	3	250
240	SHTB-240	4	2x150
300	SHTB-300	4	2x200

A	MOLD	P	W/M
16 mm ²	SHTB-16-D	1	45
25	SHTB-25-D	1	45
30	SHTB-30-D	1	45
35	SHTB-35-D	1	65
50	SHTB-50-D	3	90
70	SHTB-70-D	3	115
95	SHTB-95-D	3	150
120	SHTB-120-D	3	150
150	SHTB-150-D	3	200
185	SHTB-185-D	3	250
240	SHTB-240-D	4	2x150
300	SHTB-300-D	4	2x200

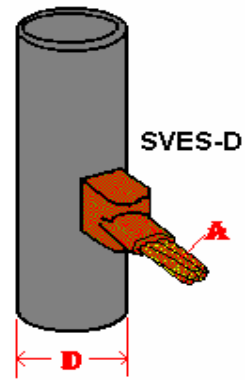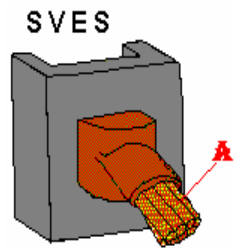



A	MOLD	P	W/M
16 mm ²	SVES-16	3	45
25	SVES-25	3	45
30	SVES-30	3	45
35	SVES-35	3	65
50	SVES-50	3	90
70	SVES-70	3	115
95	SVES-95	3	115
120	SVES-120	3	115
150	SVES-150	3	150
185	SVES-185	3	200
240	SVES-240	3	200
300	SVES-300	3	250

A	MOLD	P	W/M
16 mm ²	SVES-16-D	3	45
25	SVES-25-D	3	45
30	SVES-30-D	3	45
35	SVES-35-D	3	65
50	SVES-50-D	3	90
70	SVES-70-D	3	115
95	SVES-95-D	3	115
120	SVES-120-D	3	115
150	SVES-150-D	3	150
185	SVES-185-D	3	200
240	SVES-240-D	3	200
300	SVES-300-D	3	250

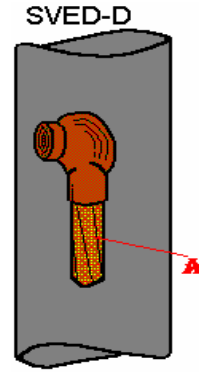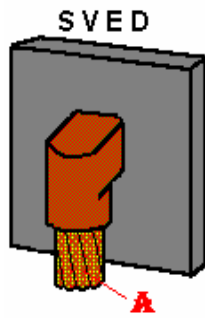


A	MOLD	P	W/M
16 mm ²	SVED-16	3	65
25	SVED-25	3	65
30	SVED-30	3	65
35	SVED-35	3	90
50	SVED-50	3	90
70	SVED-70	3	150
95	SVED-95	3	150
120	SVED-120	3	200
150	SVED-150	3	200
185	SVED-185	3	250
240	SVED-240	5	2x150
300	SVED-300	5	2x200

A	MOLD	P	W/M
16 mm ²	SVED-16-D	3	65
25	SVED-25-D	3	65
30	SVED-30-D	3	65
35	SVED-35-D	3	90
50	SVED-50-D	3	90
70	SVED-70-D	3	150
95	SVED-95-D	3	150
120	SVED-120-D	3	200
150	SVED-150-D	3	200
185	SVED-185-D	3	250
240	SVED-240-D	5	2x150
300	SVED-300-D	5	2x200

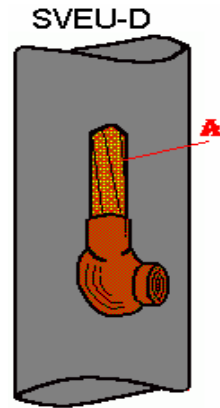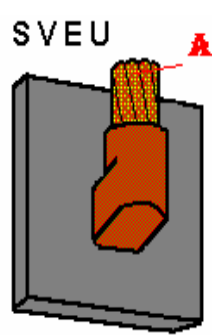


A	MOLD	P	W/M
16 mm ²	SVEU-16	3	65
25	SVEU-25	3	65
30	SVEU-30	3	65
35	SVEU-35	3	90
50	SVEU-50	3	90
70	SVEU-70	3	150
95	SVEU-95	3	150
120	SVEU-120	3	200
150	SVEU-150	3	200
185	SVEU-185	3	250
240	SVEU-240	5	2x150
300	SVEU-300	5	2x200


A	MOLD	P	W/M
16 mm ²	SVEU-16-D	3	65
25	SVEU-25-D	3	65
30	SVEU-30-D	3	65
35	SVEU-35-D	3	90
50	SVEU-50-D	3	90
70	SVEU-70-D	3	150
95	SVEU-95-D	3	150
120	SVEU-120-D	3	200
150	SVEU-150-D	3	200
185	SVEU-185-D	3	250
240	SVEU-240-D	5	2x150
300	SVEU-300-D	5	2x200

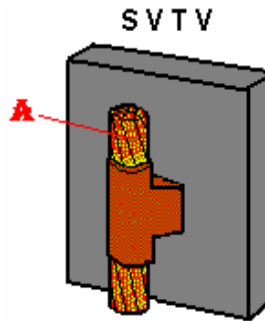

A	MOLD	P	W/M
16 mm ²	SVTV-16	3	90
25	SVTV-25	3	90
30	SVTV-30	3	90
35	SVTV-35	3	115
50	SVTV-50	5	150
70	SVTV-70	5	200
95	SVTV-95	5	250
120	SVTV-120	5	250
150	SVTV-150	5	2x150


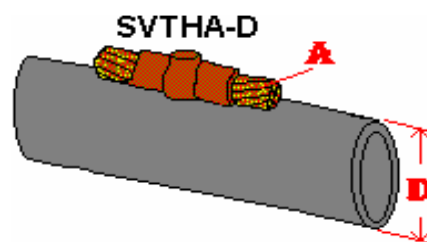


SVTHA

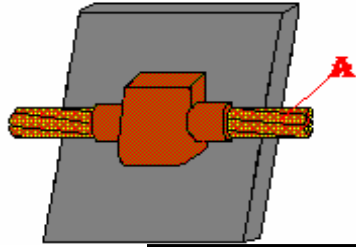

A	MOLD	P	W/M
16 mm ²	SVTHA-16	3	45
25	SVTHA-25	3	45
30	SVTHA-30	3	45
35	SVTHA-35	3	65
50	SVTHA-50	3	90
70	SVTHA-70	3	115
95	SVTHA-95	3	150
120	SVTHA-120	3	150
150	SVTHA-150	3	200
185	SVTHA-185	3	200
240	SVTHA-240	3	250
300	SVTHA-300	3	2x200


A	MOLD	P	W/M
16 mm ²	SVTHA-16-D	3	45
25	SVTHA-25-D	3	45
30	SVTHA-30-D	3	45
35	SVTHA-35-D	3	65
50	SVTHA-50-D	3	90
70	SVTHA-70-D	3	115
95	SVTHA-95-D	3	150
120	SVTHA-120-D	3	150
150	SVTHA-150-D	3	200
185	SVTHA-185-D	3	200
240	SVTHA-240-D	3	250
300	SVTHA-300-D	3	2x200

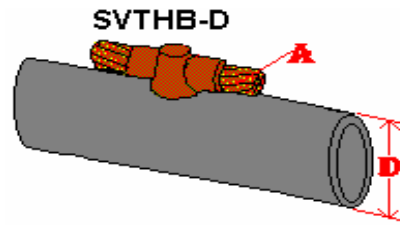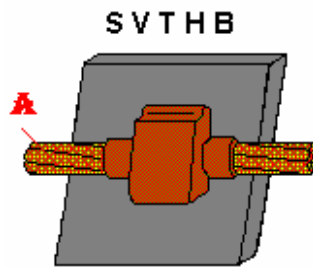

A	MOLD	P	W/M
16 mm ²	SVTHB-16	3	65
25	SVTHB-25	3	65
30	SVTHB-30	3	65
35	SVTHB-35	3	90
50	SVTHB-50	3	115
70	SVTHB-70	3	150
95	SVTHB-95	3	150
120	SVTHB-120	3	150
150	SVTHB-150	3	200
185	SVTHB-185	3	250
240	SVTHB-240	5	2x150
300	SVTHB-300	5	2x200


A	MOLD	P	W/M
16 mm ²	SVTHB-16-D	3	65
25	SVTHB-25-D	3	65
30	SVTHB-30-D	3	65
35	SVTHB-35-D	3	90
50	SVTHB-50-D	3	90
70	SVTHB-70-D	3	115
95	SVTHB-95-D	3	150
120	SVTHB-120-D	3	150
150	SVTHB-150-D	3	200
185	SVTHB-185-D	3	250
240	SVTHB-240-D	4	2x150
300	SVTHB-300-D	4	2x200

SVEH

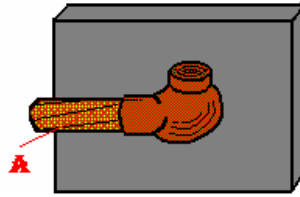

A	MOLD	P	W/M
16 mm ²	SVEH-16-(L/R)	3	45
25	SVEH-25-(L/R)	3	45
30	SVEH-30-(L/R)	3	45
35	SVEH-35-(L/R)	3	65
50	SVEH-50-(L/R)	3	90
70	SVEH-70-(L/R)	3	115
95	SVEH-95-(L/R)	3	115
120	SVEH-120-(L/R)	3	115
150	SVEH-150-(L/R)	3	150
185	SVEH-185-(L/R)	3	200
240	SVEH-240-(L/R)	3	200
300	SVEH-300-(L/R)	3	250

Note: L/R : specify the cable turn left or right.

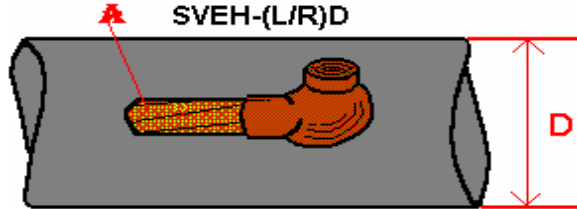

A	MOLD	P	W/M
16 mm ²	SVEH-16-(L/R)D	3	45
25	SVEH-25-(L/R)D	3	45
30	SVEH-30-(L/R)D	3	45
35	SVEH-35-(L/R)D	3	65
50	SVEH-50-(L/R)D	3	90
70	SVEH-70-(L/R)D	3	115
95	SVEH-95-(L/R)D	3	115
120	SVEH-120-(L/R)D	3	115
150	SVEH-150-(L/R)D	3	150
185	SVEH-185-(L/R)D	3	200
240	SVEH-240-(L/R)D	3	200
300	SVEH-300-(L/R)D	3	250

Note: L/R : specify the cable turn left or right.